

Name:	Spiddal	Number:	144
--------------	---------	----------------	-----


- General**

Authority/Owner:	Galway County Council
Grid Reference:	M125218 on Map 45.
Nearest Population Centre:	Spiddal, 0.3km
Utility:	Fishing. Sea Angling. Tourist/Amenity. Pleasure Craft. 6 boats.
Landings:	In-shore fishing. Shell fishing.
Interest Groups:	
Contact Names and Phone Numbers:	

- Structure**

Structures:	Pier, angled, with high stepped Stormwall and large batter at back of Stormwall.		
Sizes of Structures:	229.3m long and width varies 6.4m to 8.1m.		
Construction Types:	Stone.		
Condition of Structures:	Fairly good on berthage face. Holes, erosion, stones missing and undermining at batter at back of Stormwall.		
Structures Repair Needs:	Repairs and strengthening of the batter plus strong heavy armour or equal placed along bottom and to a height of about 4m all along toe of batter. The undermined part of the batter at the nose needs urgent attention.		
Deck Types:	Mostly concrete deck full width. Inner leg near the root has 2m wide band of stone paving near the edge and concrete screed on remaining width.		
Condition of Decks:	Fairly good.		
Decks Repair Needs:	New concrete deck inner leg (near the root).		
Depth to Bed:	5.8m	Depth to High Water Mark:	1.8m
Depth to Water Level on Survey Date:	2.9m at 0850 hours.		
Moorings:	11 stone bollards, 6 rings.		
Condition of Moorings:	Fairly good. A ring at outer stepwell and a bollard at the inner stepwell are badly placed as the mooring ropes cross the stepwell.		
Moorings Repair/Upgrade Needs:	6 extra rings on outer part and 3 extra rings on part at root.		
Heritage Value:	4		

Location Map

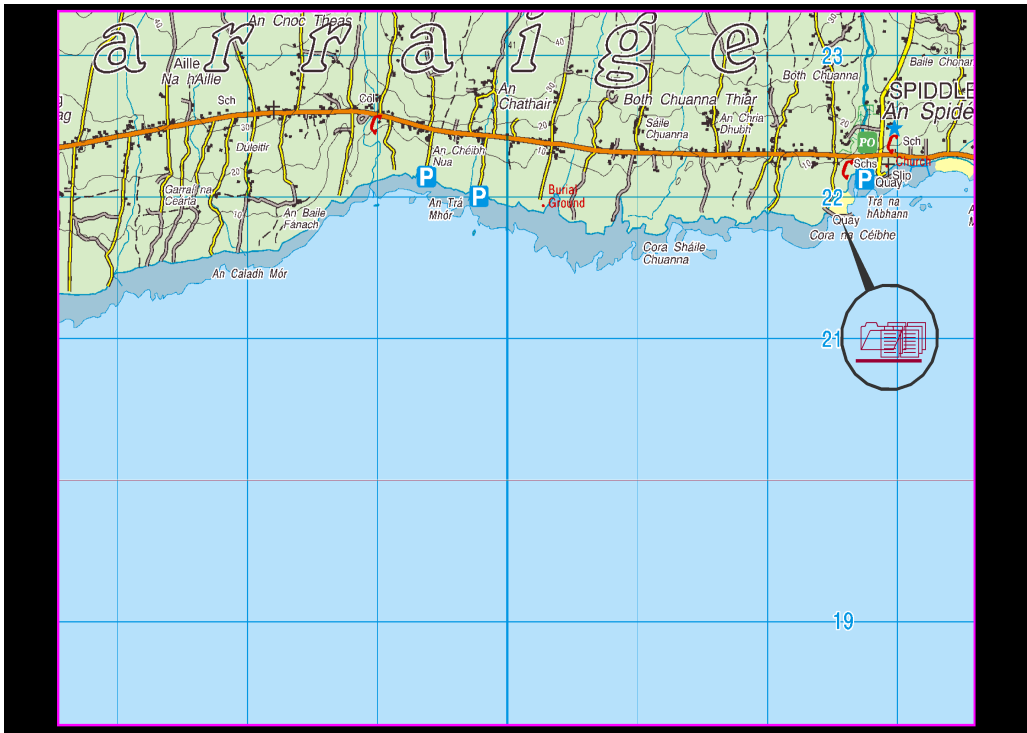

Photographs













